

praktijkrichtlijn

NPR-IEC/TR 61400-24 (en; fr)

Wind turbine generator systems - Part 24:
Lightning protection (IEC/TR 61400-
24:2002,IDT)

november 2002
ICS 27.180

Als Nederlandse praktijkrichtlijn is aanvaard:
- IEC/TR 61400-24:2002,IDT

Nederlands Elektrotechnisch Comité (NEC)
Normcommissie NEC 88 "Wind turbines"

Apart from exceptions provided by the law, nothing from this publication may be duplicated and/or published by means of photocopy, microfilm, storage in computer files or otherwise, which also applies to full or partial processing, without the written consent of the Netherlands Standardization Institute.

The Netherlands Standardization Institute shall, with the exclusion of any other beneficiary, collect payments owed by third parties for duplication and/or act in and out of law, where this authority is not transferred or falls by right to the Reproduction Rights Foundation.

Auteursrecht voorbehouden. Behoudens uitzondering door de wet gesteld mag zonder schriftelijke toestemming van het Nederlands Normalisatie-instituut niets uit deze uitgave worden veeleenvoudigd en/of openbaar gemaakt door middel van fotokopie, microfilm, opslag in computerbestanden of anderszins, hetgeen ook van toepassing is op gehele of gedeeltelijke bewerking.

Het Nederlands Normalisatie-instituut is met uitsluiting van ieder ander gerechtigd de door derden verschuldigde vergoedingen voor veeleenvoudiging te innen en/of daartoe in en buiten rechte op te treden, voor zover deze bevoegdheid niet is overgedragen c.q. rechtens toekomt aan de Stichting Reprecht.

Although the utmost care has been taken with this publication, errors and omissions cannot be entirely excluded. The Netherlands Standardization Institute and/or the members of the committees therefore accept no liability, not even for direct or indirect damage, occurring due to or in relation with the application of publications issued by the Netherlands Standardization Institute.


Hoewel bij deze uitgave de uiterste zorg is nagestreefd, kunnen fouten en onvolledigheden niet geheel worden uitgesloten. Het Nederlands Normalisatie-instituut en/of de leden van de commissies aanvaarden derhalve geen enkele aansprakelijkheid, ook niet voor directe of indirecte schade, ontstaan door of verband houdend met toepassing van door het Nederlands Normalisatie-instituut gepubliceerde uitgaven.

Voorbeeld
Preview

TECHNICAL REPORT

IEC TR 61400-24

First edition
2002-07

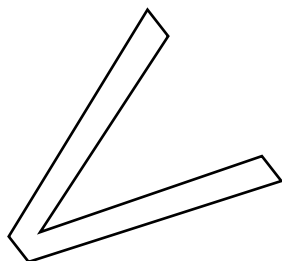

Wind turbine generator systems –

**Part 24:
Lightning protection**

Preview

Copyright



Reference number
IEC/TR 61400-24:2002(E)

Publication numbering

As from 1 January 1997 all IEC publications are issued with a designation in the 60000 series. For example, IEC 34-1 is now referred to as IEC 60034-1.

Consolidated editions

The IEC is now publishing consolidated versions of its publications. For example, edition numbers 1.0, 1.1 and 1.2 refer, respectively, to the base publication, the base publication incorporating amendment 1 and the base publication incorporating amendments 1 and 2.

Further information on IEC publications

The technical content of IEC publications is kept under constant review by the IEC, thus ensuring that the content reflects current technology. Information relating to this publication, including its validity, is available in the IEC Catalogue of publications (see below) in addition to new editions, amendments and corrigenda. Information on the subjects under consideration and work in progress undertaken by the technical committee which has prepared this publication, as well as the list of publications issued, is also available from the following:

- **IEC Web Site (www.iec.ch)**

- **Catalogue of IEC publications**

The on-line catalogue on the IEC web site (www.iec.ch/catlg-e.htm) enables you to search by a variety of criteria including text searches, technical committees and date of publication. On-line information is also available on recently issued publications, withdrawn and replaced publications, as well as corrigenda.

- **IEC Just Published**

This summary of recently issued publications (www.iec.ch/JP.htm) is also available by email. Please contact the Customer Service Centre (see below) for further information.

- **Customer Service Centre**

If you have any questions regarding this publication or need further assistance, please contact the Customer Service Centre.

Email: custserv@iec.ch
Tel: +41 22 919 02 11
Fax: +41 22 919 03 00

TECHNICAL REPORT

IEC TR 61400-24

First edition
2002-07

Wind turbine generator systems – Part 24: Lightning protection

Preview

© IEC 2002 — Copyright - all rights reserved

No part of this publication may be reproduced or utilized in any form or by any means, electronic or mechanical, including photocopying and microfilm, without permission in writing from the publisher.

International Electrotechnical Commission, 3, rue de Varembe, PO Box 131, CH-1211 Geneva 20, Switzerland
Telephone: +41 22 919 02 11 Telefax: +41 22 919 03 00 E-mail: inmail@iec.ch Web: www.iec.ch



Commission Electrotechnique Internationale
International Electrotechnical Commission
Международная Электротехническая Комиссия

PRICE CODE

V

For price, see current catalogue

CONTENTS

FOREWORD	5
INTRODUCTION	7
1 Scope	8
2 Definitions	8
3 Lightning and wind turbines	12
3.1 The properties of lightning	12
3.2 Lightning discharge formation and electrical parameters	12
3.3 Cloud-to-ground flashes	13
3.4 Upward initiated flashes	17
3.5 Lightning protection of wind turbines – the generic problem	19
3.6 Existing IEC standards and technical reports dealing with lightning protection	20
4 Damage statistics	21
4.1 Data on wind turbine lightning damage	21
4.2 Damage statistics	21
4.3 Database merits and weaknesses	27
4.4 Conclusions and recommendations	28
5 Evaluation of the risk of lightning damage to a wind turbine	29
5.1 Introduction	29
5.2 Assessing the lightning flash frequency to a wind turbine	29
5.3 Use of IEC 61024-1-1	30
5.4 Use of IEC 61662	32
5.5 Analysis of blade lightning protection system costs	34
5.6 Analysis of lightning protection costs for wind turbine control systems	35
6 Lightning protection of wind turbine blades	36
6.1 Blade structure	36
6.2 Blade damage mechanism	38
6.3 Lightning protection for wind turbine blades	38
6.4 Interception efficiency	40
6.5 Sizing of materials	41
6.6 Blade to hub connection	43
6.7 Carbon reinforced plastic (CRP)	43
6.8 Wiring inside blades	43
7 Protection of bearings and gearbox	44
7.1 Damage to bearings due to AC and DC currents	44
7.2 Damage to bearings due to lightning currents	44
7.3 Laboratory investigations	44
7.4 Lightning damage to gearbox	45
7.5 Lightning protection of bearings and gearbox elements	45
8 Protection of electrical and control system	46
8.1 Introduction	46
8.2 Configuration of electrical equipment	46
8.3 Lightning protection zones	50
8.4 Surge coupling mechanisms	52
8.5 Bonding and shielding	53

8.6	Surge protection	56
8.7	Summary	58
9	Earthing	58
9.1	Lightning protection system earth termination for a single wind turbine	58
9.2	Lightning protection system earth terminations in a wind farm	60
10	Personnel safety	61
10.1	General	61
11	Conclusions and recommendations for further work	62
Annex A Typical lightning damage questionnaire.....		64
Bibliography.....		66
Figure 1	– Processes involved in the formation of a cloud-to-ground flash [4].....	14
Figure 2	– Typical profile of a negative cloud-to-ground flash (not to scale)	15
Figure 3	– Typical profiles of negative cloud-to-ground flashes (not to scale)	16
Figure 4	– Typical profile of a positive cloud-to-ground flash	17
Figure 5	– Typical profile of a negative upward-initiated flash.....	17
Figure 6	– Different profiles of negative upward initiated flashes (not to scale).....	18
Figure 7	– Faults by component (Germany).....	23
Figure 8	– Faults by component (Denmark).....	23
Figure 9	– Faults by component (Germany).....	24
Figure 10	– Faults by component (Denmark).....	24
Figure 11	– Repair costs by component and size (Germany).....	25
Figure 12	– Average down time by component and size (Germany).....	25
Figure 13	– Annual variation in lightning activity and damage (Denmark)	26
Figure 14	– Faults caused by lightning (Denmark 1990-1998).....	26
Figure 15	– Lightning damage events (Germany 1991-1998).....	27
Figure 16	– Equivalent collection area of the wind turbine.....	30
Figure 17	– Types of wind turbine blades	37
Figure 18	– Lightning protection for large modern wind turbine blades.....	39
Figure 19	– Alternative current path to reduce lightning current.....	46
Figure 20	– Principle configuration of electrical equipment in a grid-connected wind turbine	47
Figure 21	– Principle control system configuration.....	49
Figure 22	– Rolling sphere model.....	50
Figure 23	– Example of the division of the interior of a wind turbine into protection zones.....	51
Figure 24	– Differential and common mode coupling	53
Figure 25	– Two control cabinets located on different metallic planes inside a nacelle	54
Figure 26	– Magnetic coupling mechanism.....	55
Figure 27	– Example design of a combination type SPD.....	57
Figure 28	– Typical wind turbine earthing arrangement	59

Table 1 – Cloud-to-ground lightning current parameters	15
Table 2 – Upward initiated lightning current parameters	18
Table 3 – Standards and technical reports issued by IEC (Mid 2001)	20
Table 4 – IEC TC 81 work in progress (Mid 2001)	21
Table 5 – Lightning damage frequency	22
Table 6 – Regional effect on lightning damage (Germany)	22
Table 7 – Lightning fault summary (Sweden)	23
Table 8 – Energy and availability loss compared to other faults	26
Table 9 – Lightning protection system levels	31
Table 10 – Maximum values of lightning parameters corresponding to protection levels	32
Table 11 – Minimum dimensions of lightning protection system materials	41
Table 12 – Proposed minimum dimensions for lightning protection system materials	41
Table 13 – Physical characteristics of typical materials used in lightning protection systems	42
Table 14 – Temperature rise [K] for different conductors as a function of W/R	42
Table 15 – Lightning protection zones	50
Table 16 – Examples of component requirements in given zones	52
Table 17 – Effect of various protection measures on screen transient voltages	56
Table 18 – Suitability of electrode types	60

INTERNATIONAL ELECTROTECHNICAL COMMISSION

WIND TURBINE GENERATOR SYSTEMS –

Part 24: Lightning protection

FOREWORD

- 1) The IEC (International Electrotechnical Commission) is a worldwide organization for standardization comprising all national electrotechnical committees (IEC National Committees). The object of the IEC is to promote international co-operation on all questions concerning standardization in the electrical and electronic fields. To this end and in addition to other activities, the IEC publishes International Standards. Their preparation is entrusted to technical committees; any IEC National Committee interested in the subject dealt with may participate in this preparatory work. International, governmental and non-governmental organizations liaising with the IEC also participate in this preparation. The IEC collaborates closely with the International Organization for Standardization (ISO) in accordance with conditions determined by agreement between the two organizations.
- 2) The formal decisions or agreements of the IEC on technical matters express, as nearly as possible, an international consensus of opinion on the relevant subjects since each technical committee has representation from all interested National Committees.
- 3) The documents produced have the form of recommendations for international use and are published in the form of standards, technical specifications, technical reports or guides and they are accepted by the National Committees in that sense.
- 4) In order to promote international unification, IEC National Committees undertake to apply IEC International Standards transparently to the maximum extent possible in their national and regional standards. Any divergence between the IEC Standard and the corresponding national or regional standard shall be clearly indicated in the latter.
- 5) The IEC provides no marking procedure to indicate its approval and cannot be rendered responsible for any equipment declared to be in conformity with one of its standards.
- 6) Attention is drawn to the possibility that some of the elements of this technical report may be the subject of patent rights. The IEC shall not be held responsible for identifying any or all such patent rights.

The main task of IEC technical committees is to prepare International Standards. However, a technical committee may propose the publication of a technical report when it has collected data of a different kind from that which is normally published as an International Standard, for example “state of the art”.

Technical reports do not necessarily have to be reviewed until the data they provide are considered to be no longer valid or useful by the maintenance team.

IEC 61400-24, which is a technical report, has been prepared by IEC technical committee 88: Wind turbine systems.

The text of this technical report is based on the following documents:

Enquiry draft	Report on voting
88/128/CDV	88/142/RVC

Full information on the voting for the approval of this technical report can be found in the report on voting indicated in the above table.

This publication has been drafted in accordance with the ISO/IEC Directives, Part 3.

This document, which is purely informative, is not to be regarded as an International Standard.

The committee has decided that the contents of this publication will remain unchanged until 2007. At this date, the publication will be either

- reconfirmed;
- withdrawn;
- replaced by a revised edition, or
- amended.

Forbiede
Preview

INTRODUCTION

During the last few years damage to wind turbines due to lightning strokes has been recognized as an increasing problem. The increasing number and height of installed turbines have resulted in an incidence of lightning damage greater than anticipated with repair costs beyond acceptable levels. The influence of lightning faults on operational reliability becomes a concern as the capacity of individual wind turbines increases and turbines move offshore. This is particularly the case when several large wind turbines are operated together in wind farm installations since the potential loss of multiple large production units due to one lightning flash is unacceptable.

Unlike other electrical installations, such as overhead lines, substations and power plants, where protective conductors can be arranged around or above the installation in question, wind turbines pose a different lightning protection problem due to their physical size and nature. Wind turbines typically have two or three blades with a diameter up to 100 m or more rotating 100 m above the ground. In addition, there is extensive use of insulating composite materials, such as glass fibre reinforced plastic, as load-carrying parts. The lightning protection system has to be fully integrated into the different parts of the wind turbines to ensure that all parts likely to be lightning attachment points are able to withstand the impact of the lightning and that the lightning current may be conducted safely from the attachment points to the ground without unacceptable damage or disturbances to the systems.

To that end this report was developed to inform designers, purchasers, operators, certification agencies and installers of wind turbines on the state-of-the-art of lightning protection of wind turbines.

Preview
Copyright

WIND TURBINE GENERATOR SYSTEMS –

Part 24: Lightning protection

1 Scope

During the last few years, all major wind turbine manufacturers have made dedicated efforts towards developing adequate lightning protection systems, and the first experiences with these new designs are beginning to be seen. It is therefore reasonable at this time to consider and prepare for a standardization effort that will give both manufacturers and operators a common framework for appropriate lightning protection of wind turbines.

On the above background the following elements of work have formed the scope of a new working group with the specific aim of preparing a technical report on the subject prior to considering development of a full standard:

- identify the generic problems involved in lightning protection of wind turbines;
- collect and systematize existing experience with both older and new designs of wind turbines;
- describe appropriate methods for evaluating the risk of lightning damage to wind turbines, thereby making reliable cost-benefit evaluations of lightning protection efforts possible;
- describe and outline appropriate methods for lightning protection of wind turbine components, considering the special nature of wind turbines and the extensive use of composite materials;
- compile a technical report outlining problems and solutions as seen today. The working group should identify and quantify areas where further research and proper standardization efforts are needed.

This technical report is structured as follows:

- clause 3 gives the background on the current understanding on lightning phenomenology and its impact on wind turbines;
- clause 4 presents the lightning damage experience as extracted from the various national wind turbine databases;
- clause 5 describes risk evaluation;
- clauses 6 through 10 discuss appropriate methods for protection against lightning damage;
- clause 11 identifies areas for further research.

2 Definitions

For the purposes of this technical report, the following definitions apply.

2.1

accepted lightning flash frequency (N_c)

maximum accepted average annual frequency of lightning flashes which can cause damage to the structure

2.2

air-termination system

part of the external LPS which is intended to intercept lightning flashes

Bestelformulier

Stuur naar:

NEN Standards Products & Services
t.a.v. afdeling Klantenservice
Antwoordnummer 10214
2600 WB Delft



NEN Standards Products & Services

Postbus 5059
2600 GB Delft

Vlinderweg 6
2623 AX Delft

T (015) 2 690 390
F (015) 2 690 271

www.nen.nl/normshop

Ja, ik bestel

__ ex. NPR-IEC/TR 61400-24:2002 en;fr Generatorsystemen voor
windturbines - Deel 24: Bescherming tegen blikseminslag

€ 182.95

**Wilt u deze norm in PDF-formaat? Deze bestelt u eenvoudig via
www.nen.nl/normshop**

Gratis e-mailnieuwsbrieven

Wilt u op de hoogte blijven van de laatste ontwikkelingen op het gebied van normen,
normalisatie en regelgeving? Neem dan een gratis abonnement op een van onze
e-mailnieuwsbrieven. www.nen.nl/nieuwsbrieven

Gegevens

Bedrijf / Instelling

T.a.v. O M O V

E-mail

Klantnummer NEN

Uw ordernummer BTW nummer

Postbus / Adres

Postcode Plaats

Telefoon Fax

Factuuradres (indien dit afwijkt van bovenstaand adres)

Postbus / Adres

Postcode Plaats

Datum Handtekening

Retourneren

Fax: 015 2 690 271

E-mail: klantenservice@nen.nl

Post: NEN Standards Products
& Services,

t.a.v. afdeling Klantenservice
Antwoordnummer 10214,
2600 WB Delft

(geen postzegel nodig).

Voorwaarden

- De prijzen zijn geldig tot 31 december 2018, tenzij anders aangegeven.
- Alle prijzen zijn excl. btw, verzend- en handelingskosten en onder voorbehoud bij o.m. ISO- en IEC-normen.
- Bestelt u via de normshop een pdf, dan betaalt u geen handeling en verzendkosten.
- Meer informatie: telefoon 015 2 690 391, dagelijks van 8.30 tot 17.00 uur.
- Wijzigingen en typfouten in teksten en prijsinformatie voorbehouden.
- U kunt onze algemene voorwaarden terugvinden op: www.nen.nl/leveringsvoorwaarden.